

# **Temperature and Humidity Sensor**

#### 1 Features

Supply voltage range: 2.0V to 5.5V
Temperature range: -45°C to 130°C
Relative humidity range: 0 to 100%
Typical accuracy: ±3%RH / ±3%°C

· ADC resolution: 16Bit

• Digital output: I2C bus speed of 1 MHz

• Slave Address: 0x44, 0x45

 Single-Chip Solution for Temperature and Humidity

# 2 Applications

- · Smart home
- · Air quality/dehumidifier
- · Washer & dryer
- · Consumer electronics
- Cold chain transportation
- Wireless sensor

# 3 Description


GD30TSHT30 is a temperature and relative humidity sensor with an I2C interface. It is a CMOS-MEMS sensor based on GigaDevice innovation technology. In addition, the sensor's I2C interface features two distinctive and selectable I2C addresses, with I2C communication speeds of up to 1MHz. The chip is packaged in a miniaturized DFN package with dimensions of 2.50mm x 2.50mm and a thickness of only 0.9mm. This allows the GD30TSHT30 to be widely integrated into various applications. Moreover, its wide supply voltage range of 2.0V to 5.5V makes it adaptable to multiple power supply environments.

#### Device Information<sup>1</sup>

PART NUMBER	PACKAGE	BODY SIZE (NOM)	
GD30TSHT30	DFN-8	2.50mm x 2.50mm	

1. For packaging details, see *Package Information* section.

# **Simplified Application Schematic**

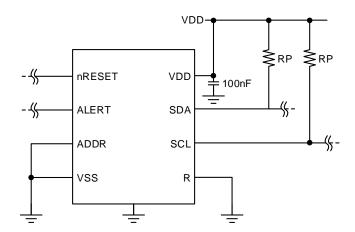



# **Table of Contents**


1	Feat	ures	
2	Appl	lications	1
3	Desc	cription	1
Tab	le of (	Contents	2
4	Devi	ice Overview	3
	4.1	Pin Assignment	3
	4.2	Pin Description	3
5	Para	ameter Information	4
	5.1	Absolute Minimum and Maximum Ratings	
	5.2	Recommended Operation Conditions	
	5.3	Electrical Sensitivity	
	5.4	Electrical Characteristics	5
	5.5	Humidity Sensor Characteristics	6
	5.6	Temperature Sensor Characteristics	7
6	Fund	ctional Description	8
	6.1	Block Diagram	8
	6.2	Operation	8
7	Appl	lication Information	19
	7.1	Typical Application Circuit	19
8	Pack	kage Information	20
	8.1	Outline Dimension	20
9	Orde	ering Information	22
10	Revi	ision History	23



## 4 Device Overview

# 4.1 Pin Assignment

# DFN Package 8-Pin Top View

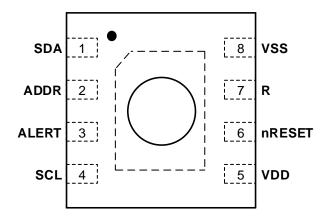

# 4.2 Pin Description

PII	NS	PIN	FUNCTION	
NAME	NUM	TYPE <sup>1</sup>	TONCTION	
SDA	1	Ю	Data pin; input/output.	
ADDR	2	I	Address pin, input; connect to either logic high or low, do not leave floating.	
ALERT	3	0	Indicates alarm condition; will be set high if the set threshold is exceeded;	
ALLINI	3	0	output; must be left floating if unused	
SCL	4	Ю	Serial clock; input/output	
VDD	5	Р	Supply voltage; input	
nRESET	6	ı	Reset pin active low; input; if not used, it is recommended to be left	
IIILOLI	(LSE)		floating.	
R	7		No electrical function; to be connected to VSS.	
VSS	8	G	Ground.	

<sup>1.</sup> P = power, G = Ground, I = input, O = Output, IO=input and output.



### 5 Parameter Information

# 5.1 Absolute Minimum and Maximum Ratings

Exceeding the operating temperature range (unless otherwise noted)<sup>1</sup>

SYMBOL	PARAMETER	MIN	MAX	UNIT
V <sub>DD</sub>	Power supply	-0.3	6	V
Vio	Voltage at SCL, SDA, ADDR, ALERT and nRESET	-0.3	VDD+0.3	V
I <sub>IN</sub>	Input current on any range	-100	100	mA
TA	Operating temperature range	-40	130	°C
T <sub>stg</sub>	Storage temperature	-40	150	°C

<sup>1.</sup> The maximum ratings are the limits to which the device can be subjected without permanently damaging the device. Note that the device is not guaranteed to operate properly at the maximum ratings. Exposure to the absolute maximum rating conditions for extended periods may affect device reliability.

## 5.2 Recommended Operation Conditions

SYMBOL <sup>1</sup>	PARAMETER	MIN	TYP	MAX	UNIT
$V_{DD}$	Supply voltage	2.0	3.3	5.5	V
TA	Operating Temperature range	-40		130	°C

# 5.3 Electrical Sensitivity

SYMBOL <sup>1</sup>	OL <sup>1</sup> CONDITIONS		UNIT
Vesd(HBM)	Human-body model (HBM), ANSI/ESDA/JEDEC JS-001-2017 <sup>1</sup>	±6000	V
Vesd(cdm)	Charge-device model (CDM), ANSI/ESDA/JEDEC JS-002-2022 <sup>2</sup>	±750	V

<sup>1.</sup> JEDEC document JEP155 states that 500-V HBM allows safe manufacturing with a standard ESD control process.

<sup>2.</sup> JEDEC document JEP157 states that 250-V CDM allows safe manufacturing with a standard ESD control process.



## 5.4 Electrical Characteristics

Typical values correspond to temperatures of 25°C, while maximum and minimum values correspond to temperatures of −45°C and 130°C, respectively.

SYMBOL	PARAMETER	CONDITIONS	MIN	TYP	MAX	UNIT
Power supp	oly	•				•
V <sub>DD</sub>	Power Supply Voltage		2.0	3.3	5.5	V
V <sub>POR</sub>	Power-up/down level		1.8	1.9	2.0	V
$V_{\text{DD,slew}}$	Slew rate change of the supply voltage				20	V/ms
		Idle state(single shot mode) T = 25°C		0.2	2	
I <sub>DD</sub>		Idle state(single shot mode) T = 125°C			6	
	Supply current	Idle state(periodic data acquisition mode) T = 125°C		45		μA
		Measuring		600	1500	
		Average		1.7		
Гон	Alert Output driving			1.5 x VDD		mA
Pheater	Heater power	Heater running	3.6		3.3	mW
Timing Spe	cification for the Sensor S	ystem (−40 °C to 125 °C and 2.4 V to 5.5	V)			•
t <sub>PU</sub>	Power-up time	After hard reset, V <sub>DD</sub> ≥ V <sub>POR</sub>		0.5	1	ms
tsr	Soft reset time	After soft reset		0.5	1.5	ms
tresentn	Duration of reset pulse		1			us
t <sub>MEAS,I</sub>		Low repeatability		2.5	4	ms
t <sub>MEAS,m</sub>	Measurement duration	Medium repeatability		4.5	6	ms
t <sub>MEAS,h</sub>		High repeatability		12.5	15.5	ms
Timing Spe	cification for the Sensor S	ystem (−40 °C to 125 °C and 2.4V to 5.5	V)			•
tpu	Power-up time	After hard reset, V <sub>DD</sub> ≥ V <sub>POR</sub>		0.5	1.5	ms
t <sub>MEAS,I</sub>		Low repeatability		2.5	4.5	ms
t <sub>MEAS,m</sub>	☐ ☐ Measurement duration	Medium repeatability		4.5	6.5	ms
t <sub>MEAS,h</sub>		High repeatability		12.5	15.5	ms



# 5.5 Humidity Sensor Characteristics

PARAMETER	CONDITIONS	MIN	TYP	MAX	UNIT
Humidity Range		0		100	%RH
Accuracy	Тур		±3		%RH
	Low		0.25		%RH
Repeatability Error	Medium		0.15		%RH
	High		0.10		%RH
Resolution	Тур		0.01		%RH
Hysteresis	At 25°C		±0.8		%RH
Response Time	τ63%		8		Second
Long Term Drift	Тур			0.25	%RH /year

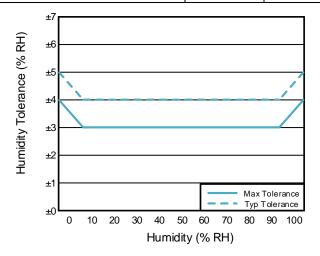


Figure 1. Tolerance of RH @25°C for GD30TSHT30

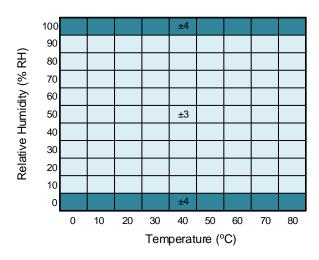


Figure 2. Tolerance of GD30TSHT30 Under Different Temperature Conditions



### 5.6 Temperature Sensor Characteristics

PARAMETER	CONDITIONS	MIN	TYP	MAX	UNIT
Operating Range		-45		130	°C
Accuracy	-40°C to 90°C		±0.3		°C
	Low		0.24		°C
Repeatability Error	Medium		0.12		°C
	High		0.06		°C
Resolution	Тур		0.015		°C
Response Time	τ63%		2		second
Long Term Drift	Max			0.03	°C/year

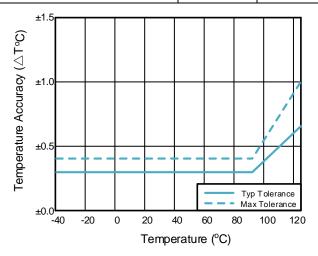


Figure 3. Temperature Accuracy of GD30TSHT30

When operating within the recommended normal temperature and humidity range (5°C to 60°C and 20%RH to 80%RH respectively), the sensor exhibits optimal performance. Long-term exposure to conditions outside the normal range, especially under high humidity for extended periods, may temporarily offset the relative humidity signal. Once back within the normal temperature and humidity range, the sensor will slowly return to its calibrated state on its own.



# 6 Functional Description

# 6.1 Block Diagram

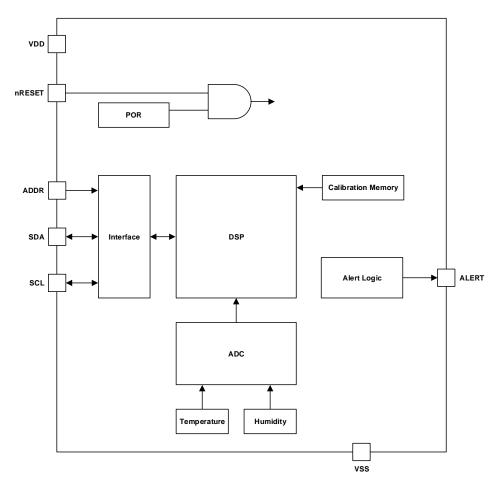


Figure 4. GD30TSHT30 Block Diagram

#### 6.2 Operation

#### 6.2.1 Overview

GD30TSHT30 supports I2C fast mode (up to 1MHz), Clock stretching can be turned on and off by specific commands. For more I2C protocol descriptions, please refer to NXP's I2C Bus Protocol Description.

After each command is sent to the sensor, wait at least 1ms before sending the next command to the sensor. All GD30TSHT30 commands and data are mapped into a 16-bit address space. In addition, all data and commands are protected with a CRC checksum, which is used to enhance the reliability of data transmission. The 16-bit command already contains the CRC check result in the lower three bits. The data sent and received by the sensor needs to be followed by an 8-bit CRC.

When the microcontroller writes data to the sensor, it must be accompanied by a CRC check byte, because GD30TSHT30 only receives data with correct CRC checksum. When reading the data of the sensor, the microcontroller is required to process the CRC check.



#### 6.2.2 Pin Assignment

#### 6.2.2.1 Power Pin (VDD, VSS)

The power supply pins must be decoupled with a 100nF capacitor that shall be placed as closed to the sensor as possible.

#### Serial Clock and Serial Data(SCL, SDA) 6.2.2.2

SCL is used to synchronize the communication between microcontroller and the sensor. The clock frequency can be freely chosen between 0 to 1MHz. Commands with clock stretching according to I<sup>2</sup>C Standard are supported.

The SDA pin is used to transfer I<sup>2</sup>C data. Communication with frequencies up to 400KHz must meet the I<sup>2</sup>C Fast Mode1 standard. Communication with frequencies up to 1MHz must meet the specification conditions in Figure 5.

Both SCL and SDA are open-drain output pins with reverse-biased diodes connected to VDD and GND. SCL and SDA must be pulled up to VDD by an external resistor. Devices on the I2C bus can only pull the bus down to ground. The pull-up resistors are required to pull the signal high. The recommended pull-up resistor is 4.7K, and resistors with different resistance values need to be selected according to different communication rates. It should be noted that pull-up resistors may be included in some microcontrollers.

#### 6.2.2.3 Thermal Pad

The center pad (thermal pad) is in the middle of the backside of the chip and is internally connected to ground within the sensor chip so there is no need to consider the electrical connection of the center pad. However, based on mechanical stress considerations, the center pad should still be soldered on the PCB.

#### 6.2.2.4 **ADDR Pin**

The I<sup>2</sup>C address of the sensor can be changed by changing the connection method of ADDR. When ADDR is connected to a low level, the address of the sensor chip is 0x44, and when ADDR is connected to a high level, the address of the sensor chip is 0x45. It should be noted that the level of ADDR cannot be changed during the communication process. This address selection method can connect two GD30TSHT30s to the same I2C bus.

It should be noted that the I<sup>2</sup>C address is represented through the 7 MSBs of the I<sup>2</sup>C read or write header. The LSB of the read-write command header is the read-write indicator bit, 0 for writing and 1 for reading. The pins of ADDR cannot be left floating.

Table 1. I2C device Address

GD30TS002T	I <sup>2</sup> C ADDRESS in HEX. REPRESENTATION	CONDITION
I <sup>2</sup> C Address A	0x44(default)	ADDR (pin 7) connected to logic low
I <sup>2</sup> C Address B	0x45	ADDR (pin 7) connected to logic high

#### 6.2.2.5 Alert Pin

The Alert pin can be connected to the interrupt pin of the microcontroller. The output value of the Alert pin depends on the comparison result between the temperature and humidity value converted by the sensor and the set threshold. Its specific functions are described in the dedicated alarm documentation. This pin needs to be left



floating when the alarm function is not used. When the output temperature and humidity value exceed the set threshold range, this pin outputs a high level. It should be noted that this pin can only be connected to the gate of the transistor to switch the transistor.

#### 6.2.2.6 nRESET pin

A reset signal can be given to the sensor through the nRESET pin. The reset signal is active low with a minimum pulse width of 1 $\mu$ s. Its function will be explained in detail in the fourth section. If not used, it is recommended to leave this pin floating or use a resistor greater than  $2k\Omega$  to pull this pin up to VDD. In fact, this pin has been pulled up to VDD by a  $50k\Omega$  resistor inside the chip.

#### 6.2.3 Power-Up and Communication Start

When the power supply voltage exceeds V<sub>POR</sub>, the sensor starts powering-up. After reaching this threshold voltage the sensor needs the time t<sub>PU</sub> to enter idle state. Once in the idle state, the chip is ready to receive commands and data from the microcontroller.

According to the I<sup>2</sup>C communication protocol, each communication of the sensor chip must start with a START signal and end with a STOP signal. When the sensor is powered up, but not receiving communication or temperature and humidity conversion commands, it automatically enters the idle state, which is convenient for reducing the power consumption. The idle state is determined internally by the chip and is not controlled by the user.

#### 6.2.4 Temperature and Humidity Measurement

To perform temperature and humidity measurement, you need to first send a start signal, then send an I<sup>2</sup>C write operation header, followed by a 16-bit temperature and humidity conversion command. After receiving each byte of data sent by the host controller, the sensor will pull the SDA bus low to give an ACK signal. The complete process of temperature and humidity measurement and data reading is shown Table 2. After correctly receiving the temperature and humidity conversion command and sending an ACK signal to the microprocessor, the GD30TSHT30 internally starts the conversion measurement of temperature and humidity.

#### 6.2.5 Measurement Commands for Single Shot Data Acquisition Mode

After receiving these commands, the device will enter the single shot data acquisition mode. After completing temperature and humidity conversion, it will store the temperature and humidity data in the interface register and wait for the microcontroller to read the measurement data. Each data pair consists of one 16-bit temperature with 8-bit CRC, followed by one 16-bit humidity data with 8-bit CRC, see section 6.2.5 for details.

In single shot mode different 16-bit measurement commands can be selected, see Table 2 for details. The difference between them is the repeatability and clock stretching (enabled and disabled).

A higher repeatability corresponds to a longer conversion duration, a higher energy consumption, and a higher conversion accuracy.



Table 2. Measurement commands in single shot mode The first SCL idle period indicates a wait time of at least 1ms (Clear blocks are controlled by the microcontroller, grey blocks by the sensor)

CONI	NOITION	HEX (	CODE
REPEATABILITY	CLOCK STRETCHING	K STRETCHING MSB	
High			06
Medium	enabled	0x2C	0D
Low			10
High			00
Medium	disabled	0x24	0B
Low			16
E.g., 0x2C06: high repeatabilit	y, clock stretching enabled.		
S I2C Address	W A Command MSB A Comm	nand LSB A P SCL Free  Measurement ongoing	S I2C Address R
NA P  Measurement  A SCL Pulled Lov  Measurement ongoing	ongoing Measurement completed I2C R	Address R A ead Header Clock Stretching Disabled	<b>→</b>
Temperature MS	B A Temperature LSB  16Bit Temperature Value	A CRC A	<b>→</b>
Humidity MSB	-	A CRC NA P	
The first SCL idle period incomply the sensor)	licates a wait time of at least 1ms	checkSum CheckSum	the microcontroller, grey block

#### 6.2.6 Readout of Measurement Results for Single Shot Mode

In case the user needs the temperature data but does not want to process CRC data, it is recommended to read the two temperature bytes, then the read transfer can be aborted with a with a NACK.

After the sensor completes the temperature and humidity measurement, the master can read the measurement result by sending the START condition followed by an I<sup>2</sup>C read header. If the temperature and humidity data is ready, the device will send an ACK condition to the master, and then send two bytes of temperature data followed by one byte CRC checksum and two bytes of humidity data followed by one byte CRC checksum.

The master must send ACK condition to each byte of data received, otherwise the device will stop sending data.

The microcontroller should send a NACK and a STOP condition to end this data transmission after receiving the CRC byte of the humidity data, as shown in Table 2.

The I<sup>2</sup>C master can abort the data transmission with a NACK condition at any time. For example, I<sup>2</sup>C does not care about the CRC result of the temperature data or does not care about the subsequent humidity data. It can



terminate the data transmission after receiving the desired data for saving time.

#### No Clock Stretching:

If the clock stretching function is disabled, after sending the temperature and humidity conversion command, if the temperature and humidity conversion has not been completed, the temperature and humidity data will be read, and the device will give NACK at this time. Only when the waiting time is long enough to ensure that the temperature and humidity conversion has been completed and then read the data will the device respond.

#### Clock Stretching On:

When clock stretching is on, regardless of whether the temperature and humidity measurement is completed, as long as the master sends the read data header, the device will give ACK and then pull SCL low. Once the measurement is completed, the SCL bus will be released immediately, and then the device will start sending the measured temperature and humidity data.

#### 6.2.7 **Measurement Commands for Periodic Data Acquisition Mode**


After receiving the command to convert the temperature and humidity periodically, the device will periodically convert the temperature and humidity. Different periodic conversion modes can be selected, as shown in Table 3. The main difference between these commands is the repeatability (high, medium, low) and data acquisition frequency (e.g., 0.5, 1, 2, 4 & 10 measurements per second, mps). Clock stretching cannot be selected in this mode.

The data acquisition frequency and the repeatability setting influence the measurement duration and the power consumption, see Parameter Information for details.

Table 3. Measurement Commands for Periodic Data Acquisition Mode

CONDITION		HEX CODE		
REPEATABILITY	MPS	MSB	LSB	
High			32	
Medium	0.5	0x20	24	
Low			2F	
High			30	
Medium	1	0x21	26	
Low			2D	
High			36	
Medium	2	0x22	20	
Low			2B	
High			34	
Medium	4	0x23	22	
Low			29	
High			37	
Medium	10	0x27	21	
Low			2A	



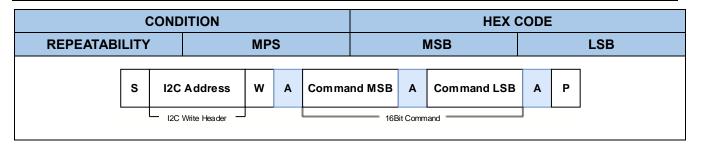

#### 6.2.8 Readout of Measurement Results for Periodic Mode

Transmission of the measurement data can be initiated through the fetch data command shown in Table 4. If no measurement data is present, the I<sup>2</sup>C read header is responded with a NACK (Bit 9 in Table 4) and the communication stops. If the master reads the temperature and humidity data, the buffer storing the temperature and humidity data will be cleared to zero until the temperature and humidity data obtained by the next measurement is loaded.

COMMAND **HEX CODE** Fetch Data 0xE000 s **I2C Address** W Α **Command MSB** Α Command LSB Α s I2C Address I2C Write Header I2C Read Header 16Bit Command Temperature MSB Temperature LSB CRC Α Α Α 16Bit Temperature Value CheckSum **Humidity MSB** Α **Humidity LSB** Α CRC NA 16Bit Humidity Value CheckSum


Table 4. Readout of Measurement Results for Periodic Mode

1. Clear blocks are controlled by the microcontroller, grey blocks by the sensor.

#### 6.2.9 Break/Stop Periodic Data Acquisition Mode

The periodic data acquisition mode can be stopped using the break command shown in Table 5. In addition to the command to read the periodic measurement temperature and humidity data, it is recommended to send the command to stop the periodic measurement mode before sending any other commands. After the device receives this command, it will exit the periodic measurement mode and enter the single shot mode after the current measurement is completed. This mode switching time takes 1ms.

Table 5. Readout of Measurement Results for Periodic Mode

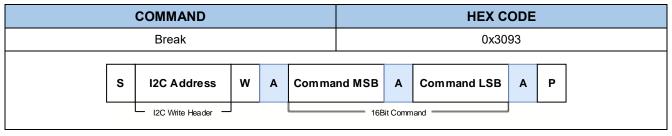



1. Clear blocks are controlled by the microcontroller, grey blocks by the sensor.

#### 6.2.10 Reset

The system reset of GD30TSHT30 can be realized by sending a reset command (soft reset) or sending a low-level signal to the nRESET port. In addition, a system reset is generated internally during power-up. It should be noted that the device will not process any commands from the microcontroller during the reset procedure.

In order to achieve a full reset of the device without removing the power supply, it is recommended to use the nRESET reset pin of the GD30TSHT30.

#### Soft Reset:

The GD30TSHT30 provides a soft reset mechanism to reset the system to a predefined state without removing the power supply. When the device is in an idle state, a soft reset command can be sent.0 After the device receives the soft reset command, it will reset the internal control module and reload the data in the non-volatile memory. The commands for soft reset are shown in Table 6.

COMMAND

Soft Reset

Soft Reset

Dx30A2

S I2C Address W A Command MSB A Command LSB A P

**Table 6. Soft Reset Command** 

1. Clear blocks are controlled by the microcontroller, grey blocks by the sensor.

#### Reset through General Call:

In addition, the device can be reset through the "general call" according to I<sup>2</sup>C-bus specification. This generates a reset which is functionally identical to using the nRESET pin. It should be noted that a reset generated in this way is not device specific. See Table 7 for General Call commands.

COMMAND

Address byte

Second byte

Ox00

Reset command using the general call address

Ox0006

Reset Command

General Call Address

General Call 1st Byte

General Call 2st Byte

Table 7. General Call Reset

1. Clear blocks are controlled by the microcontroller, grey blocks by the sensor.

#### Reset through the nReset Pin:

Pulling the nReset pin low generates a similar reset to a power-on reset. The nReset pin is internally connected to VDD through a pull-up resistor, so it is active low. The nReset pin has to be pulled low for at least 1µs.



#### Hard reset:

A hard reset is achieved by powering down the chip and then powering it back on. In order to prevent powering the sensor over the ESD diodes, the voltages on SDA and SCL should also be removed.

#### 6.2.11 Heater

The GD30TSHT30 is equipped with a heater inside. When the heater is turned on, the temperature of the device will increase, but the temperature range is fixed. This heater can be switched on and off with the corresponding commands (as shown in Table 8). The on/off status of the heater is also reflected in the internal status register.

**HEX CODE COMMAND MSB LSB** Heater Enable 6D 0x30 Heater Disabled 66 **I2C Address** W Command MSB Р S Command LSB Α Α I2C Write Header 16Bit Command

**Table 8. Heater Command** 

#### 6.2.12 Status Register

The status register contains heater status, alarm information, reset information, CRC check information, and command execution status. The command to read out the status register is shown in Table 9 whereas a description of the content can be seen in Table 10.

**COMMAND HEX CODE** Read Out of status register 0XF32D w **I2C Address** S **I2C Address** Command MSB Command LSB R I2C Write Header = 16Bit Command I2C Read Header CRC Register MSB Register LSB Α NA Α 16Bit Status Register Content CheckSum

Table 9. Command to Read the Status Register

1. Clear blocks are controlled by microcontroller, grey blocks by the sensor.

Table 10. Description of the Status Register

Bit	FIELD DESCRIPTION	DEFAULT
	Alert status	
15	'0': no pending alerts	<b>'</b> 0'
	'1': at least one pending alert	
14	Reserved	'0'

<sup>1.</sup> Clear blocks are controlled by microcontroller, grey blocks by the sensor.



Bit	FIELD DESCRIPTION	DEFAULT
	Heater status	
13	ʻ0' : Heater off	'0'
	'1' : Heater on	
12	Reserved	,0,
	Humidity tracking alert	
11	ʻ0' : No alert	<b>'</b> 0
	'1' : Alert	
	Temperature tracking alert	
10	ʻ0' : No alert	'0'
	'1' : Alert	
9:5	Reserved	'xxxxx'
	System reset detected	
	'0': no reset detected since last 'clear	
4	status register' command	'1'
	'1': reset detected (soft reset, hard	
	reset, nReset reset)	
3:2	Reserved	'00'
	Command execution status	
	'0': last command executed successfully	(0)
1	'1': last command not processed (An	,0,
	incorrect command was sent)	
	Write data CRC checksum status	
	'0': checksum of last write transfer was	(0)
0	correct	,0,
	'1': checksum of last write transfer failed	

### Clear status register

All flag bits (Bit15, 11, 10, 4) of the internal register can be cleared by sending commands shown in Table 11.

Table 11. Command to Clear the Status Register

COMMAND				HEX CODE							
Clear status register							0x30	41		_	
	s	I2C Address	w	Α	Comma	nd MSB	Α	Command LSB	Α	Р	
		I2C Write Header				16B	it Comm	and			

<sup>1.</sup> Clear blocks are controlled by microcontroller, grey blocks by the sensor.



#### 6.2.13 CRC Checksum

The CRC check algorithm for data transmission is shown in Table 12. The CRC check object is the 2 bytes of data transmitted before it.

**PROPERTY VALUE** CRC-8 Name Width 8 bit Protected data Read and/or write data 0X31(x8 + x5 + x4 + 1)Polynomial Initialization 0xFF Reflect input False Reflect output False Final XOR 0x00 CRC(0xBEEF) = 0x92Examples

Table 12. I<sup>2</sup>C CRC8 properties

# 6.2.14 Conversion of Signal Output

The output temperature and humidity data are 16-bit unsigned data. These data have been linearized and compensated for temperature. Converting these raw values into real temperature and humidity data can be achieved using the following formulas:

Relative humidity conversion formula (result in %RH):

$$RH = 100 \times \frac{S_{RH}}{2^{16} - 1}$$

Temperature conversion formula (result in °C & °F):

$$T \left[ {^{\circ}C} \right] = -45 + 175 \times \frac{S_T}{2^{16} - 1}$$

$$T[^{\circ}C] = -49 + 315 \times \frac{S_T}{2^{16} - 1}$$

 $S_{RH}$  and  $S_{T}$  represent the raw sensor output for humidity and temperature, respectively. Note that  $S_{RH}$  and  $S_{T}$  must be converted to decimal representation in formula calculations.




### 6.2.15 Communication Timing

Table 13. Communication timing specifications for I<sup>2</sup>C

SYMBOL	PARAMETER	CONDITIONS	MIN	TYP MAX	UNIT
fscL	SCL clock frequency		0	1000	kHz
t <sub>HD;STA</sub>	Hold time (repeated) START condition	After this period, the firstclock pulse is generated	0.24		μs
t <sub>LOW</sub>	LOW period of the SCL clock		0.65		μs
t <sub>HIGH</sub>	HIGH period of the SCL clock		0.26		ns
4	SDA hold time	Transmitting data	60	250	ns
thddat	SDA noid time	Receiving data	0		ns
tsudat	SDA set-up time		100		ns
t <sub>R</sub>	SCL/SDA rise time			300	ns
t <sub>F</sub>	SCL/SDA fall time			300	ns
t <sub>VD,DAT</sub>	SDA valid time			0.9	μs
tsu;sta	Set-up time for a repeated START condition		0.6		μs
tsu;sto	Set-up time for STOP condition		0.6		μs
СВ	Capacitive load on bus line			400	pF
VIL	Low level input voltage		0	0.3 x VDD	V
ViH	High level input voltage		0.7 x VDD	1 x VDD	V
VoL	Low level output voltage	3 mA sink current		0.66	V

<sup>1.</sup> Temperature range T=-40°C to 125°C, Voltage range VDD = VDDmin to VDDmax.

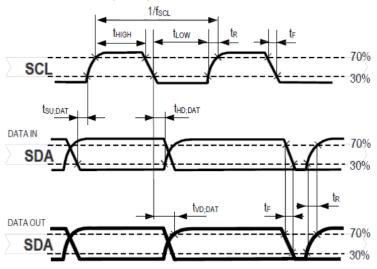

1. SDA directions are seen from the sensor. Bold SDA lines are controlled by the sensor, plain SDA lines are controlled by the micro-controller. Note that SDA valid read time is triggered by falling edge of preceding toggle

Figure 5. Timing Diagram for Digital Input/Output Pads



# 7 Application Information

The GD30TSHT30 is a single-chip integrated temperature and humidity sensor with a wide supply voltage range, supporting I2C communication. The typical application circuit is as follows.

# 7.1 Typical Application Circuit


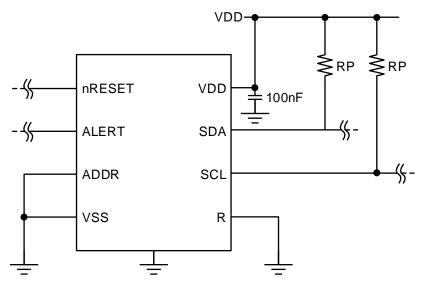


Figure 6. GD30TSHT30 Reference Circuit



# 8 Package Information

### 8.1 Outline Dimension

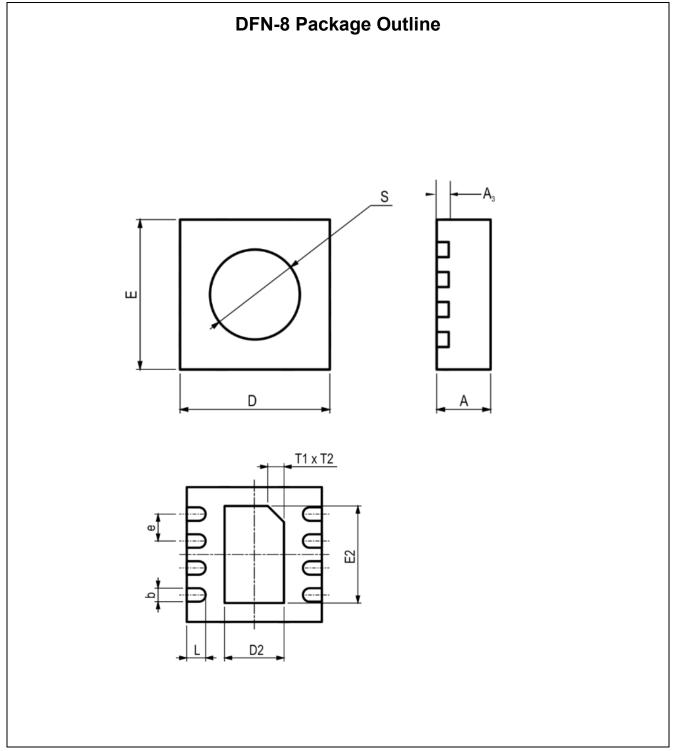

#### NOTES:

- 1. All dimensions are in millimeters.
- 2. Package dimensions does not include mold flash, protrusions, or gate burrs.
- 3. Refer to the Table 14. DFN-8 dimensions(mm).



## Table 14. DFN-8 dimensions(mm)

SYMBOL	MIN	NOM	MAX
A	0.8	0.9	1
A3		0.2	
b	0.2	0.25	0.3
D	2.4	2.5	2.6
D2	1	1.1	1.2
Е	2.4	2.5	2.6
E2	1.7	1.8	1.9
е		0.5	
L	0.25	0.35	0.45
S		1	1.5
T1xT2		0.3x0.45°	



# 9 Ordering Information

Ordering Code	Package Type	ECO Plan	Packing Type	MOQ	OP Temp(°C)
GD30TSHT30WETR-I	DFN-8	Green	Tape & Reel	2000	-40°C to +130°C
GD30TSHT30WETC-I	DFN-8	Green	Tape & Reel	2000	-40°C to +130°C

<sup>1.</sup> GD30TSHT30WETC-I chip comes with a dust-proof breathable membrane.



# 10 Revision History

REVISION NUMBER	DESCRIPTION	DATE
1.0	Initial release and device details	2024
1.1	Version upgrade	2025



# **Important Notice**

This document is the property of GigaDevice Semiconductor Inc. and its subsidiaries (the "Company"). This document, including any product of the Company described in this document (the "Product"), is owned by the Company according to the laws of the People's Republic of China and other applicable laws. The Company reserves all rights under such laws and no IntellectµAl Property Rights are transferred (either wholly or partially) or licensed by the Company (either expressly or impliedly) herein. The names and brands of third party referred thereto (if any) are the property of their respective owner and referred to for identification purposes only.

The Company makes no representations or warranties of any kind, express or implied, with regard to the merchantability and the fitness for a particular purpose of the Product, nor does the Company assume any liability arising out of the application or use of any Product described in this document. Any information provided in this document is provided only for reference purposes. It is the sole responsibility of the user of this document to determine whether the Product is suitable and fit for its applications and products planned, and properly design, program, and test the functionality and safety of its applications and products planned using the Product. Unless otherwise expressly specified in the datasheet of the Product, the Product is designed, developed, and/or manufactured for ordinary business, industrial, personal, and/or household applications only, and the Product is not designed or intended for use in (i) safety critical applications such as weapons systems, nuclear facilities, atomic energy controller, combustion controller, aeronautic or aerospace applications, traffic signal instruments, pollution control or hazardous substance management; (ii) life-support systems, other medical equipment or systems (including life support equipment and surgical implants); (iii) automotive applications or environments, including but not limited to applications for active and passive safety of automobiles (regardless of front market or aftermarket), for example, EPS, braking, ADAS (camera/fusion), EMS, TCU, BMS, BSG, TPMS, Airbag, Suspension, DMS, ICMS, Domain, ESC, DCDC, e-clutch, advancedlighting, etc.. Automobile herein means a vehicle propelled by a self-contained motor, engine or the like, such as, without limitation, cars, trucks, motorcycles, electric cars, and other transportation devices; and/or (iv) other uses where the failure of the device or the Product can reasonably be expected to result in personal injury, death, or severe property or environmental damage (collectively "Unintended Uses"). Customers shall take any and all actions to ensure the Product meets the applicable laws and regulations. The Company is not liable for, in whole or in part, and customers shall hereby release the Company as well as its suppliers and/or distributors from, any claim, damage, or other liability arising from or related to all Unintended Uses of the Product. Customers shall indemnify and hold the Company, and its officers, employees, subsidiaries, affiliates as well as its suppliers and/or distributors harmless from and against all claims, costs, damages, and other liabilities, including claims for personal injury or death, arising from or related to any Unintended Uses of the Product.

Information in this document is provided solely in connection with the Product. The Company reserves the right to make changes, corrections, modifications or improvements to this document and the Product described herein at any time without notice. The Company shall have no responsibility whatsoever for conflicts or incompatibilities arising from future changes to them. Information in this document supersedes and replaces information previously supplied in any prior versions of this document.

© 2025 GigaDevice - All rights reserved